

WELL DRILLER'S REPORT

State of Utah Division of Water Rights

For additional space, use "Additional Well Data Form" and attach

Well Identification

Non-Production Well: 1435006M00

WIN: 437680

Owner

Note any changes

Pleasant View City
520 West Elberta Drive
Pleasant View UT 84414

Contact Person/Engineer:

John Files

Well Location

Note any changes

N 2475 E 1499 from the SW corner of section 17, Township 7N, Range 1W, SL B&M

Location Description: (address, proximity to buildings, landmarks, ground elevation, local well #)

Drillers Activity

Start Date: 5/7/14

Completion Date: 6/12/14

Check all that apply: ☒ New ☐ Repair ☐ Deepen ☐ Clean ☐ Replace ☐ Public Nature of Use: Drinking water well
If a replacement well, provide location of new well. _____ feet north/south and _____ feet east/west of the existing well.

DEPTH (feet) FROM TO		BOREHOLE DIAMETER (in)	DRILLING METHOD	DRILLING FLUID
0	60	24	Dual Rotary	Air
60	120	16	Dual Rotary	Air
120	535	8	Dual Rotary	Air
535	575	8	Air Rotary	Air

Well Log

Well Log		W A T E R	P E R M E A B L E	UNCONSOLIDATED						CONSOLIDATED	ROCK TYPE	COLOR	DESCRIPTION AND REMARKS (e.g., relative %, grain size, sorting, angularity, bedding, grain composition density, plasticity, shape, cementation, consistency, water bearing, odor, fracturing, mineralogy, texture,degree of weathering, hardness, water quality, etc.)
DEPTH (feet) FROM TO				C L A Y	S A N D	G R A V E L	C O B B L E S	O T H E R					
High	Low												
0	30												
30	60			✓									
60	170	✓		✓	✓								
170	205			✓									
205	270			✓	✓	✓							
270	290					✓							
290	375			✓	✓	✓							
375	390			✓	✓								
390	415			✓		✓							
415	445			✓	✓								

RECEIVED GK

JUL 07 2014

WATER RIGHTS
SALT LAKE

RECEIVED GK

JUL 07 2014

WATER RIGHTS
SALT LAKE

Static Water Level

Date: 6/6/14 Water Level: 82 feet Flowing? ☐ Yes ☒ No
Method of Water Level Measurement: Sounder If Flowing, Capped Pressure: N/A PSI
Point to Which Water Level Measurement was Referenced: Ground Level Elevation: 7413'
Height of Water Level reference point above ground surface: 0 feet Temperature: Unknown degrees ☐ C ☐ F

Well Log

Construction Information

DEPTH (feet)		CASING			DEPTH (feet)		<input type="checkbox"/> SCREEN	<input checked="" type="checkbox"/> PERFORATIONS	<input checked="" type="checkbox"/> OPEN BOTTOM
FROM	TO	CASING TYPE AND MATERIAL/GRADE	WALL THICK (in)	NOMINAL DIAM. (in)	FROM	TO	SCREEN SLOT SIZE OR PERF SIZE (in)	SCREEN DIAM. OR PERF LENGTH (in)	SCREEN TYPE OR NUMBER PERF (per round/interval)
0	535	Steel	.322	8 5/8	170	200	1/8"		
					270	290	1/8"		
					375	390	1/8"		
					415	445	1/8"		
					490	500	1/8"		

Well Head Configuration: CappedAccess Port Provided? ☐ Yes ☒ NoCasing Joint Type: WeldedPerforator Used: Holte Air PerforatorWas a Surface Seal Installed? ☒ Yes ☐ NoDepth of Surface Seal: 110 feetDrive Shoe? ☐ Yes ☒ NoSurface Seal Material Placement Method: TremmieWas a temporary surface casing used? ☒ Yes ☐ No If yes, depth of casing: 60 feet diameter: 24 inches

DEPTH (feet)		SURFACE SEAL / INTERVAL SEAL / FILTER PACK / PACKER INFORMATION		
FROM	TO	SEAL MATERIAL, FILTER PACK and PACKER TYPE and DESCRIPTION	Quantity of Material Used (if applicable)	GROUT DENSITY (lbs./gal., # bag mix, gal./sack etc.)
0	110	Cement Grout	3050 Gallons	16 # / gal

Well Development and Well Yield Test Information

DATE	METHOD	YIELD	Units Check One		DRAWDOWN (ft)	TIME PUMPED (hrs & min)
			GPM	CFS		
	Submersible Pump (Not YJD)	300	X		76	90 hrs.

Pump (Permanent)

Pump Description: _____ Horsepower: _____ Pump Intake Depth: _____ feet

Approximate Maximum Pumping Rate: 300Well Disinfected upon Completion? ☐ Yes ☐ No**Comments**

Description of construction activity, additional materials used, problems encountered, extraordinary circumstances, abandonment procedures. Use additional well data form for more space.

Well Driller Statement

This well was drilled and constructed under my supervision, according to applicable rules and regulations, and this report is complete and correct to the best of my knowledge and belief.

Name YELLOW JACKET DRILLING SERVICES, LLC

(Person, Firm, or Corporation - Print or Type)

License No. 872

Signature

See last page

(Licensed Well Driller)

Date

State of Utah Division of Water Rights

Well Identification

Owner

Pleasant View City
520 West Elberta Drive
Pleasant View UT 84414

Well Location

Location Description: (address, proximity to buildings, landmarks, ground elevation, local well #)

[illegible]

Well Log

Construction Information (con't)	
---	--

[illegible][illegible]

Comments (con't)	
------------------	--

Well Driller Statement	This well was drilled and constructed under my supervision, according to applicable rules and regulations.
-------------------------------	--

This well was drilled and constructed under my supervision, according to applicable rules and regulations, and this report is complete and correct to the best of my knowledge and belief.

Name YELLOW JACKET DRILLING SERVICES, LLC

License No. 872

Signature T. L. Dene


Date 6.30.2014

(Licensed Well Driller)

Borehole Geology

Well Design

Borehole Geophysics

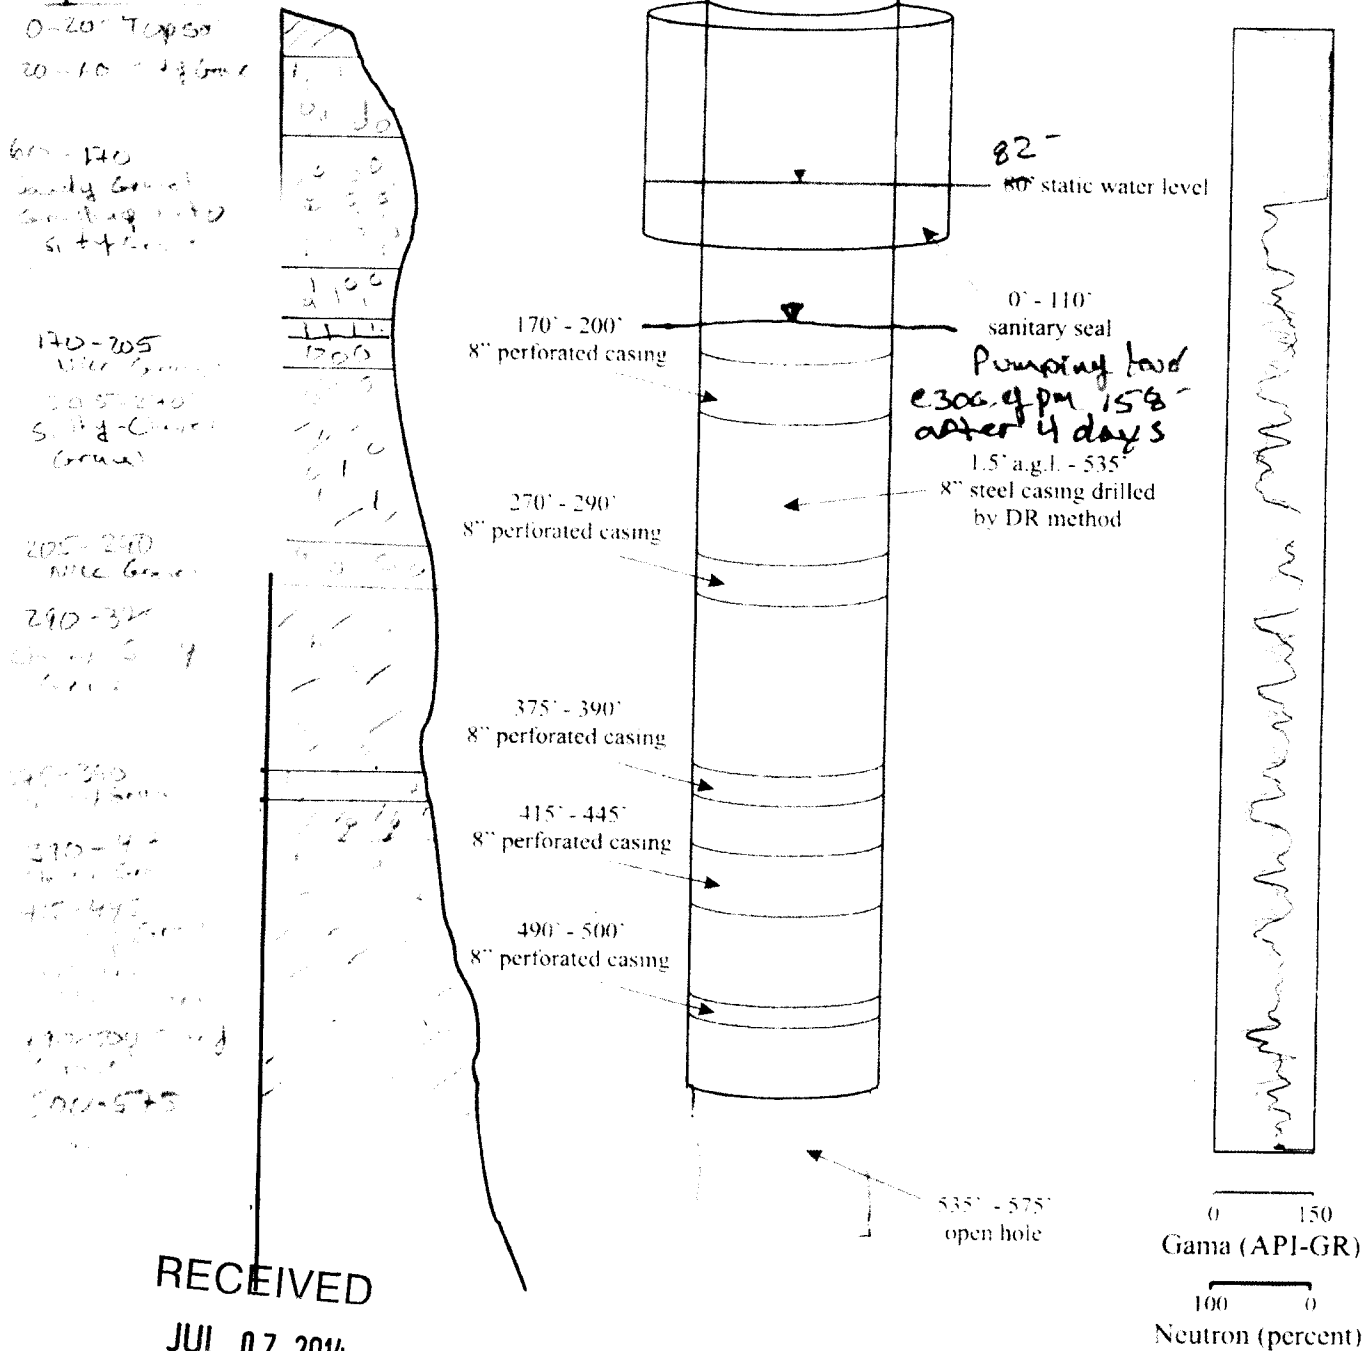

RECEIVED

JUL 07 2014

WATER RESOURCES

575' estimated alluvial/bedrock contact



Pleasant View City Well 4 DWSP Report

Drawn By:
Amanda Hintz
maps@bluesunGeographics.com

Project Manager: John Files
Date: June 2014
File: PVW4_Fig3.pdf

Figure 3
Well Design